

DRAWING 6A SQUARE EDGE PANEL SIDING VERTICAL BUTT JOINTS

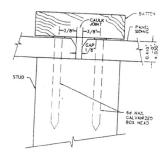


DRAWING 6B GROOVED PANEL SIDING WIDE SHIP LAP JOINT


Normal fastening where racking resistance is provided by sheathing or bracing

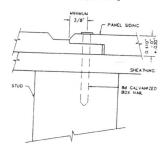

DRAWING 6C GROOVED PANEL SIDING WIDE SHIP LAP JOINT Fastening when racking resistance is provide by siding

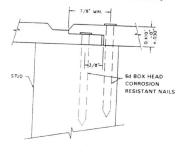

DRAWING 6D STUCCO/CYPRETEX PANELS SHORT SHIPLAP JOINT DETAIL Fastening when racking resistance is provided by siding

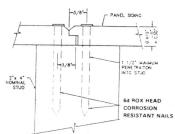

LIMITED WARRANTY

Temple-Inland Forest Products Corporation warrants to the original owner that its hardboard siding subs will be free from defects in materials and workmansimp, and will comply with the Voluntary Product Standard which is in effect at the time of manufacture, and such warranty will be valid for a period of twenty-five years. Should the product be found not to comply with this warranty at any time within twenty-five (25) years from date of installation, Temple-Inland will issue a cash refund for a prorated portion of the purchase price of the defective siding.

Temple-Inland further warrants that the factory applied primer or prefinish will not peel, crack or blister under normal conditions of use or exposure for a period of five (5) years from the date of original installation. Should the factory finish fail under this warranty, Temple-Inland will compensate the original owner in cash for the material and labor required to refinish the siding with one coat of acrylic latex housepaint.

Any claim must be made in writing to Temple-Inland Forest Products Corporation at P.O. Drawer N, Diboll, Texas 75941, within sixty (60) days after discovery of any

defect and before alterations are made. Temple-Inland must be given a reasonable time to investigate the claim

before any alterations are made.

This warranty is effective only if the siding is handled, stored, applied, finished, used, and maintained according to Temple-Inland's application instructions, and in accordance with good standards of practice within the building industry. This warranty does not apply where siding is used for trim strips, facia, mansards or skirting. This ranty is not effective when the siding is subjected to unusual physical impact, abrasion, abuse, neglect, prolonged contact with accumulated water, moisture condensation in the wall cavity, nor is this warranty effective when there is a failure to provide reasonable and necessary maintenance, including recaulking, repainting, or other normal weather protection. Temple-Inland will not be responsible for the unsatisfactory performance of its siding or for damaged siding that is caused by others not under the control of Temple-Inland.

Temple-Inland shall not be liable for incidental, indirect, special, or consequential damages arising from any breach of this warranty. Some states do not allow the exclusion or limitations of incidental or consequential damages, so the above limitation or exclusion may not apply to you.

The duration of any implied warranty shall be the same as that of the express warranty. Some states do not allow limitations on how long an implied warranty lasts, so the above limitations may not apply to you.

This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

PRODUCT QUALITY CONFORMANCE

HARDBOARD SIDING products are tested at an independent laboratory in accordance with Voluntary Product Standard ANSI/AHA A135.6 and are stamped with this mark:





APPLICATION TABLE - NAIL SIZE AND SPACING

	FRAMING (2" x 4") MAXIMUM SPACING	NAIL SIZE (7)	NAIL SPACING			MINIMUM
SIDING			SIDING ONLY (1)	RACKING STRENGTH (2)	JOINT GAP	GAP AROUND OPENINGS
LAP SIDING DIRECT TO STUDS	16"o.c.	8d	16"o.c.	Not Applicable	Slight Contact	1/8"
OVER SHEATHING	16′′o.c.	10d	16′′o.c.	Not Applicable	Slight Contact	1/8"
SELF ALIGNING LAP DIRECT TO STUDS (6)	16"o.c.	6d	16''o.c.(6)	Not Applicable	1/16'' Caulk	1/8"
OVER SHEATHING (6)	16′′oc.	8 d	16"o.c.(6)	Not Applicable	1/16'' Caulk	1/8''
SQUARE EDGE PANELS DIRECT TO STUDS	24''o.c.	6d	6"o.c. Edges 12"o.c. Intermed.	4"o.c. Edges 8"o.c. Intermed.	1/16" Cover with Batten	1/8′′
OVER SHEATHING	24"o.c.	8d	6"o.c. Edges 12"o.c. Intermed.	Not Applicable	1/16" Cover with Batten	1/8"
SHIPLAP EDGE PANELS PANEL SIDING DIRECT TO STUDS (3)(4)	24″o.c.	6d	6"o.c.(5) Edges 12"o.c. Intermed.	4"o.c. (3)(4) Edges 8"o.c. Intermed.	Moderate Contact	1/8"
OVER SHEATHING (5)	24 ′′o.c.	8d	6"o.c.(5) Edges 12"o.c. Intermed.	Not Applicable	Moderate Contact	1/8′′

- (1) Racking resistance per FHA Circular 12 provided by sheathing or corner braces.

- (1) Hacking resistance per FHA Circular 12 provided by shiding.
 (2) Racking resistance provided by siding.
 (3) Short (%") shiplap joint panels (see Drawing No. 6D).
 (4) Wide (%") shiplap joint panels (see Drawing No. 6C).
 (5) Wide (%") shiplap joint panels (see Drawing No. 6B).
 (6) See Drawings 1B, 1C, and 1D.
 (7) Box Nail with the following dimensions:

 Perpressions:

Pennyweight	Length (in.)	Diameter (in.)	Head Diameter (in.)
6d	1-7\8"	.086	.250
6d	2	.099	.266
8d	2-3/8"	.099	.266
8d	2-1/2"	.113	.297
adoral Consideration E	EN 105 P TARIE 1A or 1R		

A variance of 10% is allowable on head diameter.

Certification: Third party product certification by American Hardboard Association

 $Conforms \ to \ American \ National \ Standard \ ANSI/AHA \ A135.6 - \ 1984 \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ Voluntary \ Product \ Standard \ PS \ 60-73) \ (formerly \ PS \ 60-73) \ (fo$

Code Approvals: International Conference of Building Officials (ICBO) Report #3392 Building Officials and Code Administrators (BOCA) Report #82-31

May 1989

EAST TEX PRINTING 039

Contact Temple-Inland for special instructions concerning any type of construction not covered in this publication.



P.O. DRAWER N DIBOLL, TEXAS 75941 PHONE (409) 829-5511 U.S. WATTS 800-231-6060